


BORING BARS - RADIAL RELIEF - SOLID CARBIDE

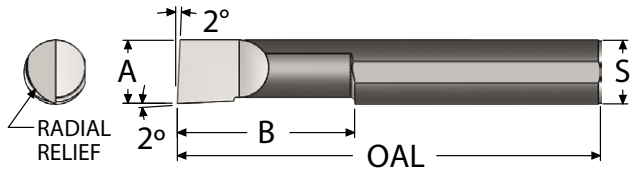

- Made with premium submicron grade carbide
- ALTiN+ coating extends tool life
- Radial relieved cutting clearance for max strength
- Polished flute face for optimal performance

"A" MIN BORE	"B" MAX DEPTH	"S" SHANK DIA.	OAL	ORDER #		EDP #	
				UNCOATED	AITiN+	UNCOATED	AITiN+
0.060	0.125	0.125	1.50	BB61	BB61A	210342	211062
0.060	0.250	0.125	1.50	BB62	BB62A	210345	211065
0.060	0.375	0.125	1.50	BB63	BB63A	210348	211068
0.060	0.500	0.125	1.50	BB64	BB64A	210351	211071
0.075	0.125	0.125	1.50	BB71	BB71A	210354	211074
0.075	0.250	0.125	1.50	BB72	BB72A	210357	211077
0.075	0.375	0.125	1.50	BB73	BB73A	210360	211080
0.075	0.500	0.125	1.50	BB74	BB74A	210363	211083
0.090	0.125	0.125	1.50	BB91	BB91A	210366	211086
0.090	0.250	0.125	1.50	BB92	BB92A	210369	211089
0.090	0.375	0.125	1.50	BB93	BB93A	210372	211092
0.090	0.500	0.125	1.50	BB94	BB94A	210375	211095
0.090	0.625	0.125	1.50	BB95	BB95A	210378	211098
0.105	0.250	0.125	1.50	BB102	BB102A	210201	210921
0.105	0.375	0.125	1.50	BB103	BB103A	210204	210924
0.105	0.500	0.125	1.50	BB104	BB104A	210207	210927
0.105	0.625	0.125	1.50	BB105	BB105A	210210	210930
0.120	0.250	0.125	1.50	BB122	BB122A	210213	210933
0.120	0.375	0.125	1.50	BB123	BB123A	210216	210936
0.120	0.500	0.125	1.50	BB124	BB124A	210219	210939
0.120	0.625	0.125	1.50	BB125	BB125A	210222	210942
0.120	0.750	0.125	1.50	BB126	BB126A	210225	210945
0.155	0.375	0.1875	2.00	BB153	BB153A	210228	210948
0.155	0.500	0.1875	2.00	BB154	BB154A	210231	210951
0.155	0.625	0.1875	2.00	BB155	BB155A	210234	210954
0.155	0.750	0.1875	2.00	BB156	BB156A	210237	210957
0.155	1.000	0.1875	2.00	BB158	BB158A	210240	210960
0.185	0.375	0.1875	2.00	BB183	BB183A	210246	210966
0.185	0.500	0.1875	2.00	BB184	BB184A	210249	210969
0.185	0.625	0.1875	2.00	BB185	BB185A	210252	210972
0.185	0.750	0.1875	2.00	BB186	BB186A	210255	210975
0.185	1.000	0.1875	2.00	BB188	BB188A	210258	210978
0.185	1.250	0.1875	2.00	BB1812	BB1812A	210243	210963

"A" MIN BORE	"B" MAX DEPTH	"S" SHANK DIA.	OAL	ORDER #		EDP #	
				UNCOATED	AITiN+	UNCOATED	AITiN+
0.220	0.500	0.250	2.00	BB224	BB224A	210264	210984
0.220	0.625	0.250	2.00	BB225	BB225A	210267	210987
0.220	0.750	0.250	2.00	BB226	BB226A	210270	210990
0.220	1.000	0.250	2.00	BB228	BB228A	210273	210993
0.220	1.250	0.250	2.50	BB2212	BB2212A	210261	210981
0.248	0.500	0.250	2.00	BB254	BB254A	210282	211002
0.248	0.625	0.250	2.00	BB255	BB255A	210285	211005
0.248	0.750	0.250	2.00	BB256	BB256A	210288	211008
0.248	1.000	0.250	2.00	BB258	BB258A	210291	211011
0.248	1.250	0.250	2.50	BB2512	BB2512A	210276	210996
0.248	1.500	0.250	2.50	BB2514	BB2514A	210279	210999
0.310	0.500	0.3125	2.00	BB314	BB314A	210303	211023
0.310	0.750	0.3125	2.00	BB316	BB316A	210306	211026
0.310	0.750	0.3125	2.50	BB316L	BB316LA	210309	211029
0.310	1.000	0.3125	2.50	BB318	BB318A	210312	211032
0.310	1.250	0.3125	2.50	BB3112	BB3112A	210294	211014
0.310	1.500	0.3125	2.50	BB3114	BB3114A	210297	211017
0.310	1.750	0.3125	3.00	BB3116	BB3116A	210300	211020
0.373	0.500	0.375	2.00	BB374	BB374A	210330	211050
0.373	0.750	0.375	2.00	BB376	BB376A	210333	211053
0.373	0.750	0.375	2.50	BB376L	BB376LA	210336	211056
0.373	1.000	0.375	2.50	BB378	BB378A	210339	211059
0.373	1.250	0.375	2.50	BB3712	BB3712A	210315	211035
0.373	1.500	0.375	2.50	BB3714	BB3714A	210318	211038
0.373	1.500	0.375	3.00	BB3714L	BB3714LA	210321	211041
0.373	1.750	0.375	3.00	BB3716	BB3716A	210324	211044
0.373	2.000	0.375	3.00	BB3718	BB3718A	210327	211047

THREAD MILLS

SINGLE POINT TOOLS
BORING

INDEXABLE TOOLS

PORT - CAVITY

SPECIALTY

SOLID CARBIDE BORING BAR FEED AND SPEED CHART

MATERIAL	HB/Rc	SPEED (SFM)		FEED IPR	CUTTING CONDITIONS					
		UNCOATED	ALTiN+		TOOL DIAMETER					
					.015-.045	.050-.100	.110-.160	.180-.230	.290-.320	.360+
					MAX DOC	MAX DOC	MAX DOC	MAX DOC	MAX DOC	MAX DOC
CAST IRON	160 HB	75-200	200-550	.0005-.010	0.006	0.008	0.010	0.014	0.020	0.031
CARBON STEEL	18 Rc	75-200	200-450	.0005-.007	0.003	0.005	0.006	0.008	0.012	0.017
ALLOY STEEL	20 Rc	75-200	200-425	.0005-.007	0.003	0.004	0.005	0.007	0.010	0.015
TOOL STEEL	25 Rc	75-175	175-300	.0005-.005	0.002	0.003	0.004	0.006	0.008	0.012
300 STAINLESS STEEL	150 HB	75-175	175-350	.0005-.005	0.003	0.003	0.004	0.006	0.008	0.013
400 STAINLESS STEEL	195 HB	75-210	130-420	.0005-.005	0.002	0.003	0.004	0.006	0.008	0.012
HIGH TEMP ALLOY (Ni & Co BASE)	20 Rc	50-130	130-300	.0005-.004	0.002	0.003	0.003	0.005	0.007	0.010
TITANIUM	25 Rc	50-120	120-275	.0005-.005	0.003	0.004	0.005	0.006	0.009	0.014
HEAT TREATED ALLOYS (38-45Rc)	40 Rc	50-100	100-200	.0005-.005	0.002	0.002	0.003	0.004	0.006	0.009
ALUMINUM	100 HB	75-250	250-750	.0005-.015	0.011	0.015	0.019	0.026	0.038	0.056
BRASS, ZINC	80 HB	75-300	250-650	.001-.010	0.009	0.012	0.015	0.021	0.030	0.045

SFM = Surface Feet Per Minute DOC = Depth of Cut IPR = Inches Per Revolution

Starting parameters only. Length-to-diameter ratios, setup, and machine rigidity may affect performance.

$$\begin{aligned} \text{SFM} &= .262 \times \text{DIAMETER} \times \text{RPM} \\ \text{RPM} &= 3.82 \times \text{SFM} \div \text{DIAMETER} \\ \text{IPM} &= \text{FPT} \times \text{Number of Teeth} \times \text{RPM} \end{aligned}$$

$$\begin{aligned} \text{Meters/Min} &= \text{SFM} \times .3048 \\ \text{Millimeters/Rev} &= \text{IPR} \times 25.40 \end{aligned}$$

SOLID CARBIDE BORING TROUBLESHOOTING

PROBLEM	CAUSE	SOLUTION
RAPID FLANK WEAR	CUTTING CONDITIONS	Check for excessive speed and feed - See chart.
	TOOL	Select a coated tool.
	PART	Make sure prior operation did not work harden the metal.
BUILT-UP EDGE	TOOL	Select a coated tool.
	CUTTING FORCE	Check for excessive feed rate (IPR) - See chart.
	HEAT	Use the SCT coolant holder. If coolant is not available, use shop air and a coated tool.
CORNER BREAKAGE	CUTTING CONDITIONS	Check for excessive feed and speed and depth of cut - see chart.
	TOOL	Select a tool with a radius. A radius is stronger than a sharp corner.
	PART	Check the drilled hole.
SURFACE TOO ROUGH	CUTTING CONDITIONS	Check for excessive feed rate (IPR) - See chart.
	BUILT-UP EDGE	See above (Built-Up Edge).
CHATTER	SET UP	Set tool above center. Reduce the overhang ratio. Clamping length should be at least 3x the boring bar diameter. Change the speed of the machine. Speed change may break up harmonics and reduce chatter.
	BORING BAR	Select the largest diameter boring bar that will bore the required diameter.
TAPER SMALLER IN BACK	CHIP PACKING	If the boring bar is too large to allow chips to evacuate, then the chips may pack on the tool and cause the bar to deflect away from the bore.
	PROGRAM	If the taper is consistent, then the program can be altered to bore a taper in opposite direction resulting in a straight hole.
TAPER BIGGER IN BACK	CUTTING FORCES	Reduce forces. Deflecting bar below center causes hole to become larger.
	BUILT-UP EDGE	Built-up edge will cause the hole to become larger until the built edge breaks off, then the hole becomes smaller.
	PROGRAM	If taper is consistent, then the program can be altered to bore a taper in the opposite direction resulting in a straight hole.

GROOVING TOOL FEED AND SPEED CHART

MATERIAL	HB/Rc	SPEED (SFM)		CUTTING CONDITIONS				
				TOOL DIAMETER				
		UNCOATED	ALTiN+	.060 -0.080	.090 -.120	.187	.250-.312	.375+
				MAX FPR	MAX FPR	MAX FPR	MAX FPR	MAX FPR
CAST IRON	160 HB	75-200	200-550	0.0010	0.0012	0.0017	0.0031	0.0044
CARBON STEEL	18 Rc	75-200	200-450	0.0007	0.0008	0.0011	0.0022	0.0030
ALLOY STEEL	20 Rc	75-200	200-425	0.0006	0.0007	0.0010	0.0019	0.0026
TOOL STEEL	25 Rc	75-175	175-300	0.0005	0.0006	0.0008	0.0015	0.0022
300 STAINLESS STEEL	150 HB	75-175	75-350	0.0006	0.0007	0.0010	0.0019	0.0026
400 STAINLESS STEEL	195 HB	75-210	130-420	0.0005	0.0006	0.0008	0.0016	0.0023
HIGH TEMP ALLOY (NICKEL & COBALT BASE)	20 Rc	50-130	130-300	0.0004	0.0005	0.0007	0.0013	0.0017
TITANIUM	25 Rc	50-120	120-275	0.0005	0.0006	0.0008	0.0016	0.0022
HEAT TREATED ALLOYS (38-45Rc)	40 Rc	50-100	100-200	0.0004	0.0004	0.0006	0.0011	0.0016
ALUMINUM	100 HB	75-250	250-750	0.0022	0.0026	0.0037	0.0065	0.0085
BRASS, ZINC	80 HB	250-300	250-650	0.0018	0.0021	0.0030	0.0053	0.0079

SFM = Surface Feet Per Minute

FPR = Feed Per Revolution

Starting parameters only. Length-to-diameter ratios, setup, and machine rigidity may affect performance.

GROOVING TOOL TROUBLESHOOTING

PROBLEM	CAUSE	SOLUTION
RAPID FLANK WEAR	CUTTING CONDITIONS	Check for excessive speed - see chart.
	TOOL	Select a coated tool.
	PART	Make sure prior operation did not work harden the material.
BUILT-UP EDGE	TOOL	Select a coated tool.
	CUTTING FORCE	Check for excessive speed rate (IPR) - see chart.
	HEAT	Use the SCT coolant holder. If coolant is not available, use shop air and a coated tool.
CHATTER	CUTTING CONDITIONS	Reduce RPM and increase feed rate within the feed and speed chart parameters.
	CLAMPING	Clamping length should be a minimum of 3x the shank diameter in the tool holder. Check tool holding rigidity.
	TOOL	Hone cutting edge. A light hone (0.0001-0.0003 inch) will help keep force constant.
TOOL BREAKAGE	CUTTING CONDITIONS	Check for excessive feed rate (IPR) - see chart.
	CHIP PACKING	Stagger - Peck grooving.

SINGLE POINT THREADING TECHNICAL CHART

MATERIAL	HB/Rc	SPEED (SFM)		FIRST PASS DEPTH					
		UNCOATED	ALTiN+	TOOL DIAMETER					
				.040-.050	.060-.092	.120-.152	.180-.232	.290-.362	.373+
CAST IRON	160 HB	75-200	200-550	0.003	0.004	0.005	0.007	0.008	0.009
CARBON STEEL	18 Rc	75-200	200-450	0.003	0.005	0.006	0.007	0.008	0.009
ALLOY STEEL	20 Rc	75-200	200-425	0.003	0.004	0.005	0.006	0.007	0.008
TOOL STEEL	25 Rc	75-175	175-300	0.002	0.003	0.004	0.005	0.006	0.007
300 STAINLESS STEEL	150 HB	75-175	175-350	0.003	0.003	0.004	0.005	0.006	0.007
400 STAINLESS STEEL	195 HB	75-210	130-420	0.003	0.004	0.005	0.006	0.006	0.007
HIGH TEMP ALLOY (NICKEL & COBALT BASE)	20 Rc	50-130	130-300	0.002	0.003	0.003	0.004	0.005	0.005
TITANIUM	25 Rc	50-100	120-275	0.003	0.003	0.004	0.005	0.006	0.007
HEAT TREATED ALLOYS (38-45Rc)	40 Rc	50-100	100-200	0.002	0.002	0.003	0.004	0.004	0.005
ALUMINUM	100 HB	75-250	200-750	0.004	0.005	0.007	0.008	0.010	0.011
BRASS, ZINC	80 HB	75-300	250-650	0.003	0.005	0.006	0.007	0.008	0.009

Parameters are a starting point based on machinability rating at hardness listed.
Check machinability rating of the material to be machined and adjust First Pass Depth.

Helpful Formulas and Information

$$\text{PITCH} = \frac{1}{\text{TPI}}$$

TPI = Threads Per Inch

ACME Thread Depth = Pitch × 0.5

Stub ACME Thread Depth = Pitch × 0.3

NPT Pipe Thread Depth = Pitch × 0.76

Internal 60° Thread Depth = Pitch × 0.54

Feed Rate = Pitch × Number of Thread Starts

Minimum Depth per Pass should not be less than 0.0003


Threads not ending in a relief need at least one thread pitch length of pullout

Make sure feed rate calculation does not exceed the maximum feed rate of the machine

SINGLE POINT THREADING TROUBLESHOOTING


PROBLEM	CAUSE	SOLUTION
RAPID FLANK WEAR	CUTTING CONDITIONS	Check for excessive speed - see chart.
	PART	Make sure prior operation did not work harden the material.
	TOOL	Select a coated tool.
BUILT-UP EDGE	TOOL	Select a coated tool.
	CUTTING FORCE	Increase the number of passes.
	HEAT	Use the SCT coolant holder. If coolant is not available, use shop air and a coated tool.
CORNER BREAKAGE	CUTTING CONDITIONS	Reduce the depth-of-cut on the first pass.
	PROGRAM	If there is no thread relief, withdraw the tool on an angle.
	PART	End in thread relief.
CHIPS WRAPPING AROUND TOOL	TOOL	Use a tool that is at least 30% smaller than the hole diameter.

RADIAL INFEEED

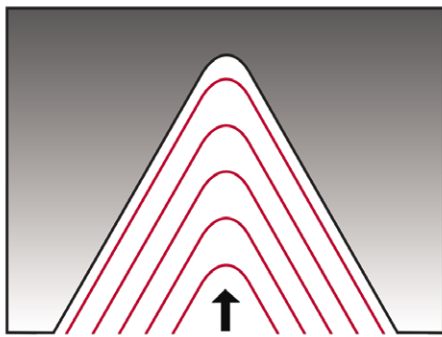

NOT RECOMMENDED

MODIFIED FLANK

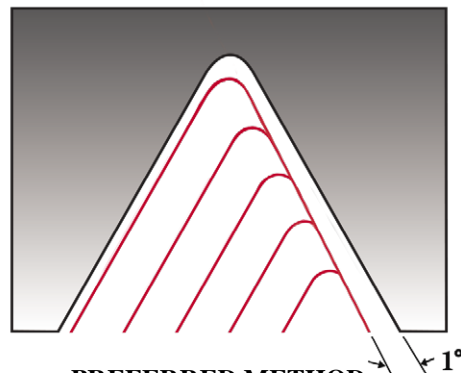

PREFERRED METHOD

Radial Infeed is not recommended. Modified flank at 1° is recommended.

For unfavorable length-to-diameter ratios or difficult-to-machine materials, the number of passes will need to be increased up to 40% more.

Depth of cut per pass should not be less than 0.0003 inch.

SINGLE POINT CBN & PCD TECHNICAL & APPLICATION

PCD TIPPED TOOL INFORMATION

SCT PCD tools and inserts are excellent for continuous cutting of a wide range of non-ferrous and non-metal materials. The products are precision ground for machining to sub-micron finishes with maximum tool life. PCD allows for higher cutting speeds with longer tool life.

SINGLE POINT TOOLS
TECH INFO

MATERIAL	BHN/Rc	SPEED RANGE (SFM)	FEED IPR	SINGLE POINT PCD TIPPED BARS			
				TOOL DIAMETER			
				.120-160 MAX DOC	.180-.230 MAX DOC	.290-.320 MAX DOC	.360+ MAX DOC
LOW SILICON ALUMINUM	225-350 BHN	1000-5000	.001-.007	0.015	0.021	0.03	0.045
HIGH SILICON ALUMINUM	270-425 BHN	600-3000	.001-.007	0.015	0.021	0.03	0.045
METAL MATRIX COMPOSITIES	N/A	500-2000	.001-.007	0.008	0.012	0.02	0.03
COPPER ALLOYS, BRASS, BRONZE	80-120 BHN	750-3500	.001-.007	0.015	0.021	0.03	0.045
PRESINTERED TUNGSTEN CARBIDE	140-300 BHN	100-350	.001-.005	0.003	0.005	0.007	0.012
ACRYLICS	N/A	700-1500	.001-.007	0.015	0.021	0.03	0.045
FIBERGLASS	N/A	600-1000	.001-.007	0.012	0.02	0.03	0.045
GRAPHITES	N/A	600-1000	.001-.007	0.015	0.021	0.03	0.045
NYLON, PLASTIC	N/A	700-1500	.001-.007	0.015	0.021	0.03	0.045
HARD RUBBER	N/A	500-2500	.001-.007	0.015	0.021	0.03	0.045

APPLICATION GUIDELINES
Make sure the machine and setup is rigid and solid. Chatter will cause chipping.
Tool height when boring should be slightly above center. Tool deflection will put the tool on center.
Do not stop the machine with the tool in cut. This will result in tool breakage.
Use of coolant will reduce heat and improve surface finish.
Do not contact the tool to a hard surface prior to the machining process- this will cause chipping.
Higher speeds minimize tool buildup.
Depth of cut should not exceed 70% of PCD tip length.

As the DOC decreases the feed rate can increase DOC = Depth of Cut SFM = Surface Feet per Minute

CBN TIPPED TOOL INFORMATION

SCT CBN tools and inserts are excellent for continuous cutting of a wide range of hardened steels, powdered metals, cast irons and super alloys. The products are precision ground with hones for machining to sub-micron finishes with maximum tool life. CBN tipped tools and inserts can take the place of grinding.

MATERIAL	BHN/Rc	SPEED RANGE (SFM)	FEED IPR	SINGLE POINT CBN TIPPED BARS			
				TOOL DIAMETER			
				.120-160 MAX DOC	.180-.230 MAX DOC	.290-.320 MAX DOC	.360+ MAX DOC
HEAT TREATED ALLOY	45-60Rc	200-600	.001-.005	0.003	0.004	0.006	0.009
TOOL STEEL	45-60Rc	200-600	.001-.005	0.003	0.004	0.006	0.009
NODULAR IRON	N/A	600-1500	.001-.005	0.006	0.01	0.02	0.03
PEARLITIC IRON	220-240BHN	600-2500	.001-.007	0.006	0.01	0.02	0.03
WHITE/CHILLED IRON	54-60Rc	200-500	.001-.005	0.005	0.008	0.012	0.015
SUPER ALLOY Ni BASE	240-475 BHN	200-800	.001-.005	0.003	0.004	0.006	0.025
COBOLT BASED ALLOY, STELLITE	45-55Rc	200-500	.001-.005	0.003	0.004	0.006	0.009
INCONELS	45-55Rc	200-500	.001-.005	0.003	0.004	0.006	0.009

APPLICATION GUIDELINES
Make sure the machine and setup is rigid and solid. Chatter will cause chipping
Tool height when boring should be slightly above center. Tool deflection will put the tool on center.
Do not stop the machine with the tool in cut. This will result in tool breakage.
Coolant use is not advised as it could cause thermal cracking.
Do not contact the tool to a hard surface prior to the machining process. This will cause chipping.
Depth of cut should not exceed 30% of CBN tip length.

As the DOC decreases the feed rate can increase DOC = Depth of Cut SFM = Surface Feet per Minute